

8570 8770, 8870 and 8970 Tractors Operation and Tests

For complete service information also see:

8570, 8770, 8870 and 8970 Tractors

Repair	TM1549
6076 Engine	
Serial Number (-499999)	CTM6
Serial Number (500000-)	CTM42
6101 Engine	CTM20
Radial Piston Pumps	CTM7
Engine Accessories	CTM11
1600 Series Axles	CTM18

John Deere Waterloo Works
TM1550 (14MAR97)

LITHO IN U.S.A.
ENGLISH

**8570, 8770, 8870
and 8970 Tractors
Operation and Test**

TM1550 (14MAR97)



Introduction

FOREWORD

This manual is written for an experienced technician. Essential tools required in performing certain service work are identified in this manual and are recommended for use.

Live with safety: Read the safety messages in the introduction of this manual and the cautions presented throughout the text of the manual.



This is the safety-alert symbol. When you see this symbol on the machine or in this manual, be alert to the potential for personal injury.

Technical manuals are divided in two parts: repair and operation and tests. Repair sections tell how to repair the components. Operation and tests sections help you identify the majority of routine failures quickly.

Information is organized in groups for the various components requiring service instruction. At the beginning of each group are summary listings of all applicable essential tools, service equipment and tools, other materials needed to do the job, service parts kits, specifications, wear tolerances, and torque values.

Technical Manuals are concise guides for specific machines. They are on-the-job guides containing only the vital information needed for diagnosis, analysis, testing, and repair.

Fundamental service information is available from other sources covering basic theory of operation, fundamentals of troubleshooting, general maintenance, and basic type of failures and their causes.

Contents

SECTION 210—General Information

- Group 05—Safety
- Group 10—Machine Operational Checks
- Group 15—General Reference Information
- Group 20—Test Equipment Calibration

SECTION 220—Engine Operation and Tests

- Group 05—General Information
- Group 10—System Diagnosis
- Group 25—Theory of Operation

SECTION 230—Fuel and Air Operation and Tests

- Group 05—Air Intake System
- Group 10—Diesel Fuel System

SECTION 240—Electrical Operation and Tests

- Group 05—Electrical System Introduction
- Group 10—Load Center, Fuses, Relays and Connectors
- Group 15—Preliminary Checks
- Group 20—Operational Checks
- Group 25—Starting Circuit
- Group 30—Charging Circuit
- Group 35—INTELLITRAK System-Tachometer Module
- Group 40—INTELLITRAK System-Performance Monitor
- Group 45—24-Speed POWRSYNC Transmission
- Group 50—Lighting Circuit
- Group 55—Accessory Circuits

SECTION 250—12-Speed Syncro & 24-Speed Powrsync™ Transmission

- Group 05—Operational Checks
- Group 10—Transmission System Diagnosis
- Group 25—Theory of Operation

SECTION 255—Power Shift Transmission

- Group 05—Operational Checks
- Group 10—Power Shift Transmission System Diagnosis
- Group 25—Power Shift Theory of Operation

SECTION 256—PTO, Axles and Differentials

- Group 25—Theory of Operation

SECTION 260—Steering and Brakes

- Group 05—Operational Checks
- Group 10—System Diagnosis
- Group 15—Steering And Brake Tests
- Group 25—Theory of Operation

SECTION 270—Hydraulic System

- Group 05—Operational Checks
- Group 10—Hydraulic System Diagnosis
- Group 10A—Hitch System Diagnosis
- Group 15—Tests
- Group 15A—Hitch System Tests
- Group 25—Theory Of Operation
- Group 25A—Hitch System Theory Of Operation

SECTION 290—Operator Station

- Group 05—Air Quality System Operational Checks
- Group 10—Air Quality System Diagnosis
- Group 25—Theory of Operation
- Group 30—Seat Diagnosis

SECTION 299—Dealer Fabricated Tools

- Group 05—Fabricated Tools

Index

All information, illustrations and specifications in this manual are based on the latest information available at the time of publication. The right is reserved to make changes at any time without notice.

TM1550-19-14MAR97

COPYRIGHT© 1993
DEERE & COMPANY
Moline, Illinois
All rights reserved
A John Deere ILLUSTRATION™ Manual

**Thanks very much for your reading,
Want to get more information,
Please click here, Then get the complete
manual**

JustClickHere 

NOTE:

**If there is no response to click on the link above,
please download the PDF document first, and then
click on it.**

**Have any questions please write to me:
admin@servicemanualperfect.com**

Contents

210

220

230

240

250

255

256

260

270

290

Contents

299

INDX

Contents

299

INDX

Section 210 General Information

210

Contents


	Page		Page
Group 05—Safety	210-05-1		
Group 10—Machine Operational Checks		Group 15—General Reference Information	
Introduction	210-10-1	ISO Hydraulic Symbols	210-15-1
Lighting Circuit	210-10-1	Torque Values	
Accessory Circuit	210-10-2	Metric	210-15-2
Differential Lock	210-10-2	Inch	210-15-3
Ether Start	210-10-3	Abbreviations	210-15-4
INTELLITRAK™ Circuits	210-10-4	PST Supplemental Test Kit	210-15-5
PST Circuit	210-10-5	Supplemental Pressure Test Kit	210-15-5
Starting Circuit	210-10-5	Supplemental Flow Test Kit	210-15-6
Engine Running Checks	210-10-6	ORFS Fitting Kit	210-15-6
Results of Electrical Check	210-10-7	Master Hyd Flow Test Fitting Kit	210-15-7
Checks for MST Transmission		CP Hyd Flow Test Kit	210-15-9
Neutral Start Check	210-10-7	Flowmeter Kit	210-15-11
Engagement Override Valve Check	210-10-7	Ag Universal Pressure Test Kit	210-15-12
Trans Oil Pressure Check	210-10-7	Required Test Fittings	210-15-13
Two-Speed Shift Check	210-10-7	Diagnostic Adaptors Check List	210-15-14
Clutch Check	210-10-8		
Shift Check	210-10-8	Group 20—Test Equipment Calibration	
Checks for PST Transmission		JDG282 Temperature Gauge Check	210-20-1
Display Check	210-10-8	NUDAY and OTC Flow Meters	210-20-1
Neutral Start	210-10-8	Method 1: Flow Meter (Main Pump)	210-20-2
Trans Oil Press Filter Check	210-10-8	Method 2: Volume Check	210-20-3
Park Brake Check	210-10-9	Pressure Gauge Calibration Checker	210-20-5
Clutch Check	210-10-9	Calibration Check	210-20-10
Shift Check	210-10-9		
PTO EOY Check	210-10-9		
PTO Brake Check	210-10-10		
Brake Accumulator Check	210-10-10		
Service Brake Check	210-10-10		
Steering Check	210-10-10		
Lamp Check	210-10-10		
Seat Height Check	210-10-11		
Differential Lock Check	210-10-11		
Hitch Checks			
Raise and Drop	210-10-12		
Rate of Drop	210-10-12		
Height Limit Checks	210-10-12		
External Raise-Lower Switch Check	210-10-12		
Selective Control Valve Check	210-10-13		
Pressurizer/Circulator Blower Motor	210-10-13		
A/C Compressor Clutch Check	210-10-13		
A/C Cooling Check	210-10-14		

PREVENT MACHINE RUNAWAY

Avoid possible injury or death from machinery runaway.

Do not start engine by shorting across starter terminals. Machine will start in gear if normal circuitry is bypassed.

NEVER start engine while standing on ground. Start engine only from operator's seat, with transmission in neutral or park.

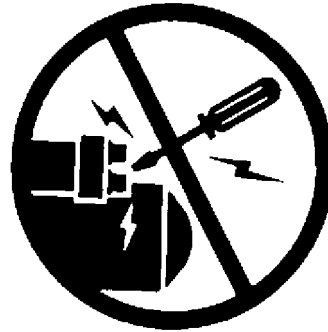

DX,BYPAS1 -19-03MAR93

210
05
1
-UN-11JAN89
TS177

HANDLE FLUIDS SAFELY—AVOID FIRES

When you work around fuel, do not smoke or work near heaters or other fire hazards.

Store flammable fluids away from fire hazards. Do not incinerate or puncture pressurized containers.

Make sure machine is clean of trash, grease, and debris.

Do not store oily rags; they can ignite and burn spontaneously.



DX,FLAME -19-04JUN90


-UN-23AUG88
TS227

PREVENT BATTERY EXPLOSIONS

Keep sparks, lighted matches, and open flame away from the top of battery. Battery gas can explode.

Never check battery charge by placing a metal object across the posts. Use a volt-meter or hydrometer.

Do not charge a frozen battery; it may explode. Warm battery to 16°C (60°F).

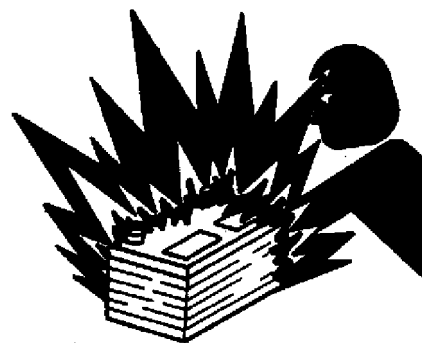

DX,SPARKS -19-03MAR93

-UN-23AUG88
TS204


210
05
2

PREPARE FOR EMERGENCIES

Be prepared if a fire starts.

Keep a first aid kit and fire extinguisher handy.

Keep emergency numbers for doctors, ambulance service, hospital, and fire department near your telephone.

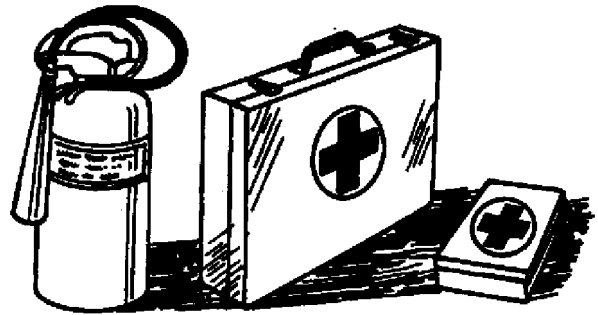

DX.FIRE2 -19-03MAR93

TS291 -UN-23AUG88

PREVENT ACID BURNS

Sulfuric acid in battery electrolyte is poisonous. It is strong enough to burn skin, eat holes in clothing, and cause blindness if splashed into eyes.

Avoid the hazard by:


1. Filling batteries in a well-ventilated area.
2. Wearing eye protection and rubber gloves.
3. Avoiding breathing fumes when electrolyte is added.
4. Avoiding spilling or dripping electrolyte.
5. Use proper jump start procedure.

If you spill acid on yourself:

1. Flush your skin with water.
2. Apply baking soda or lime to help neutralize the acid.
3. Flush your eyes with water for 15—30 minutes. Get medical attention immediately.

If acid is swallowed:

1. Do not induce vomiting.
2. Drink large amounts of water or milk, but do not exceed 2 L (2 quarts).
3. Get medical attention immediately.

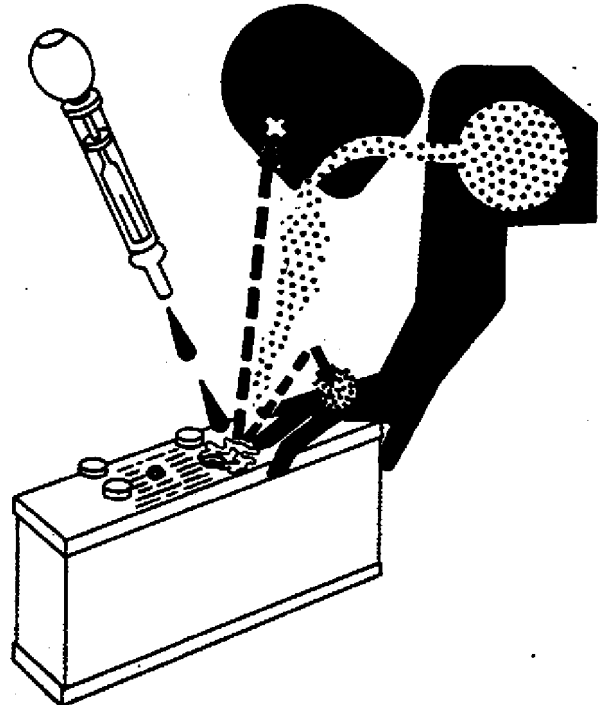

DX.POISON -19-21APR93

TS203 -UN-23AUG88

SERVICE COOLING SYSTEM SAFELY

Explosive release of fluids from pressurized cooling system can cause serious burns.

Shut off engine. Only remove filler cap when cool enough to touch with bare hands. Slowly loosen cap to first stop to relieve pressure before removing completely.



DX,RCAP -19-04JUN90

210
05
3
-UN-23AUG68
TS281


HANDLE CHEMICAL PRODUCTS SAFELY

Direct exposure to hazardous chemicals can cause serious injury. Potentially hazardous chemicals used with John Deere equipment include such items as lubricants, coolants, paints, and adhesives.

A Material Safety Data Sheet (MSDS) provides specific details on chemical products: physical and health hazards, safety procedures, and emergency response techniques.

Check the MSDS before you start any job using a hazardous chemical. That way you will know exactly what the risks are and how to do the job safely. Then follow procedures and recommended equipment.

(See your John Deere dealer for MSDS's on chemical products used with John Deere equipment.)

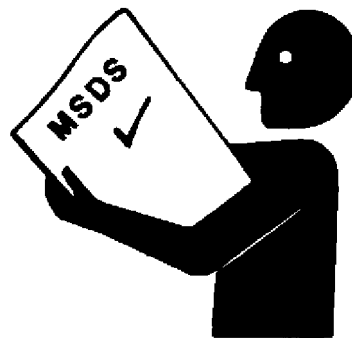

DX,MSDS,NA -19-03MAR93

-UN-26NOV90
TS1132

210
05
4


AVOID HIGH-PRESSURE FLUIDS

Escaping fluid under pressure can penetrate the skin causing serious injury.

Avoid the hazard by relieving pressure before disconnecting hydraulic or other lines. Tighten all connections before applying pressure.

Search for leaks with a piece of cardboard. Protect hands and body from high pressure fluids.

If an accident occurs, see a doctor immediately. Any fluid injected into the skin must be surgically removed within a few hours or gangrene may result. Doctors unfamiliar with this type of injury should reference a knowledgeable medical source. Such information is available from Deere & Company Medical Department in Moline, Illinois, U.S.A.

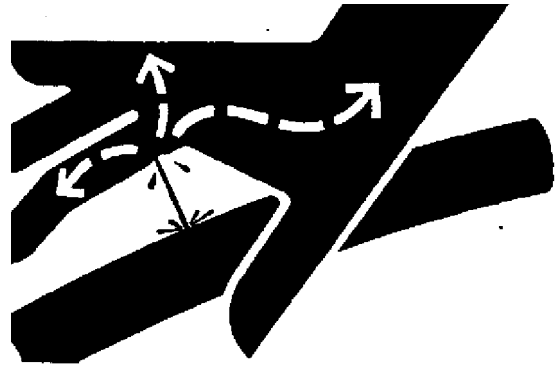


X9811 -JUN-23AUG88

DX,FLUID -19-03MAR93

PARK MACHINE SAFELY

Before working on the machine:

- Lower all equipment to the ground.
- Stop the engine and remove the key.
- Disconnect the battery ground strap.
- Hang a "DO NOT OPERATE" tag in operator station.

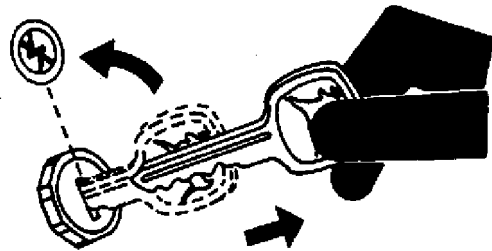


TS230 -JUN-24MAY88

DX,PARK -19-04JUN90

SUPPORT MACHINE PROPERLY

Always lower the attachment or implement to the ground before you work on the machine. If you must work on a lifted machine or attachment, securely support the machine or attachment.

Do not support the machine on cinder blocks, hollow tiles, or props that may crumble under continuous load. Do not work under a machine that is supported solely by a jack. Follow recommended procedures in this manual.

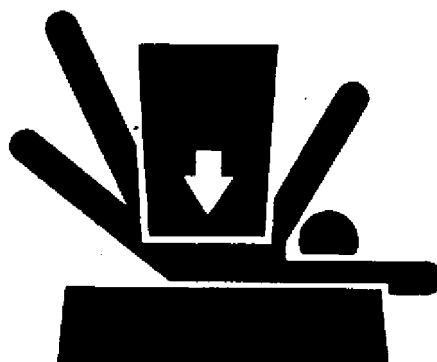

-UN-23AUG88
TS229

DX,LOWER -19-04JUN90


WEAR PROTECTIVE CLOTHING

Wear close fitting clothing and safety equipment appropriate to the job.

Prolonged exposure to loud noise can cause impairment or loss of hearing.

Wear a suitable hearing protective device such as earmuffs or earplugs to protect against objectionable or uncomfortable loud noises.

Operating equipment safely requires the full attention of the operator. Do not wear radio or music headphones while operating machine.

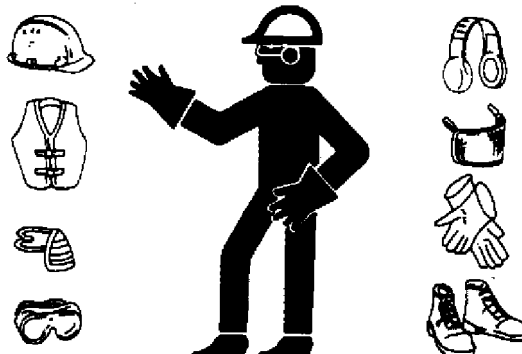


-UN-23AUG88
TS206

DX,WEAR -19-10SEP90

WORK IN CLEAN AREA

Before starting a job:

- Clean work area and machine.
- Make sure you have all necessary tools to do your job.
- Have the right parts on hand.
- Read all instructions thoroughly; do not attempt shortcuts.

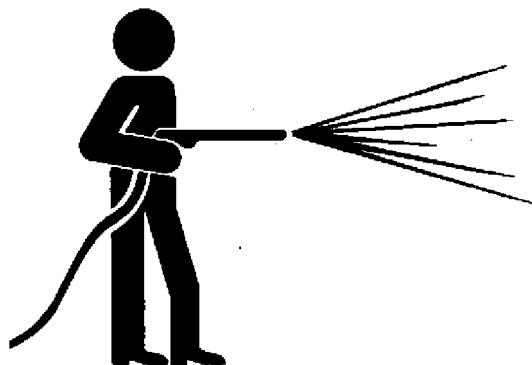

-UN-18OCT88
T6642EJ


DX,CLEAN -19-04JUN90

210
05
6

SERVICE MACHINES SAFELY

Tie long hair behind your head. Do not wear a necktie, scarf, loose clothing, or necklace when you work near machine tools or moving parts. If these items were to get caught, severe injury could result.

Remove rings and other jewelry to prevent electrical shorts and entanglement in moving parts.

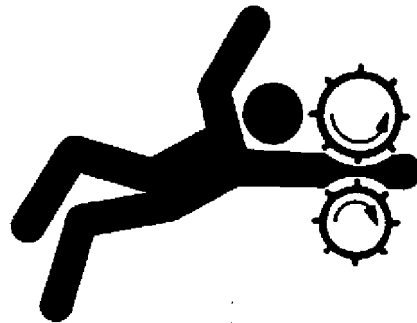


DX, LOOSE -19-04JUN90

TS228 -UN-23AUG88

WORK IN VENTILATED AREA

Engine exhaust fumes can cause sickness or death. If it is necessary to run an engine in an enclosed area, remove the exhaust fumes from the area with an exhaust pipe extension.

If you do not have an exhaust pipe extension, open the doors and get outside air into the area.

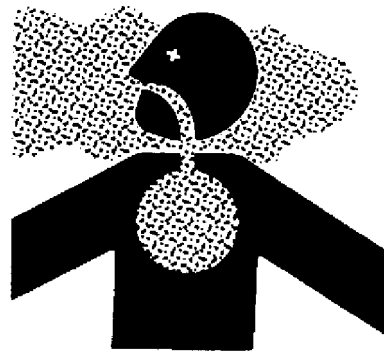

DX, AIR -19-04JUN90

TS220 -UN-23AUG88

PROTECT AGAINST HIGH PRESSURE SPRAY

Spray from high pressure nozzles can penetrate the skin and cause serious injury. Keep spray from contacting hands or body.

If an accident occurs, see a doctor immediately. Any high pressure spray injected into the skin must be surgically removed within a few hours or gangrene may result. Doctors unfamiliar with this type of injury should reference a knowledgeable medical source. Such information is available from Deere & Company Medical Department in Moline, Illinois, U.S.A.



DX, SPRAY -19-16APR92

TS1343 -UN-18MAR92

ILLUMINATE WORK AREA SAFELY

Illuminate your work area adequately but safely. Use a portable safety light for working inside or under the machine. Make sure the bulb is enclosed by a wire cage. The hot filament of an accidentally broken bulb can ignite spilled fuel or oil.




DX,LIGHT -19-04JUN90

210
05
7
-UN-23AUG88
TS223

REPLACE SAFETY SIGNS

Replace missing or damaged safety signs. See the machine operator's manual for correct safety sign placement.

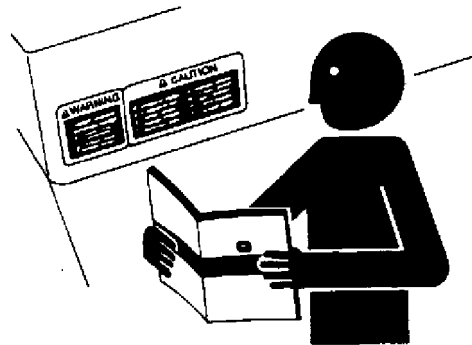


DX,SIGNS1 -19-04JUN90

-UN-23AUG88
TS201

USE PROPER LIFTING EQUIPMENT

Lifting heavy components incorrectly can cause severe injury or machine damage.

Follow recommended procedure for removal and installation of components in the manual.

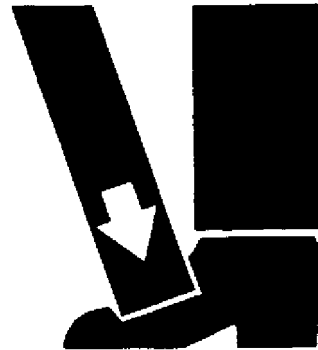

DX,LIFT -19-04JUN90

-UN-23AUG88
TS226

210
05
8

REMOVE PAINT BEFORE WELDING OR HEATING


Avoid potentially toxic fumes and dust.

Hazardous fumes can be generated when paint is heated by welding, soldering, or using a torch.

Do all work outside or in a well ventilated area. Dispose of paint and solvent properly.

Remove paint before welding or heating:

- If you sand or grind paint, avoid breathing the dust. Wear an approved respirator.
- If you use solvent or paint stripper, remove stripper with soap and water before welding. Remove solvent or paint stripper containers and other flammable material from area. Allow fumes to disperse at least 15 minutes before welding or heating.

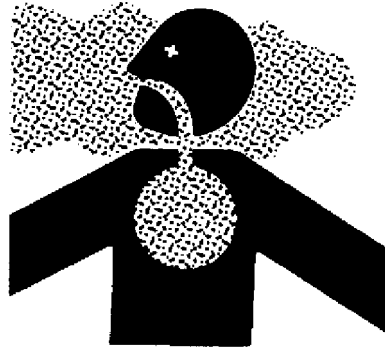

DX,PAINT -19-03MAR93

TS220 -UN-23AUG68

AVOID HEATING NEAR PRESSURIZED FLUID LINES

Flammable spray can be generated by heating near pressurized fluid lines, resulting in severe burns to yourself and bystanders. Do not heat by welding, soldering, or using a torch near pressurized fluid lines or other flammable materials. Pressurized lines can be accidentally cut when heat goes beyond the immediate flame area.




DX,TORCH -19-03MAR93

TS953 -UN-15MAY90

KEEP ROPS INSTALLED PROPERLY

Make certain all parts are reinstalled correctly if the roll-over protective structure (ROPS) is loosened or removed for any reason. Tighten mounting bolts to proper torque.

The protection offered by ROPS will be impaired if ROPS is subjected to structural damage, is involved in an overturn incident, or is in any way altered by welding, bending, drilling, or cutting. A damaged ROPS should be replaced, not reused.

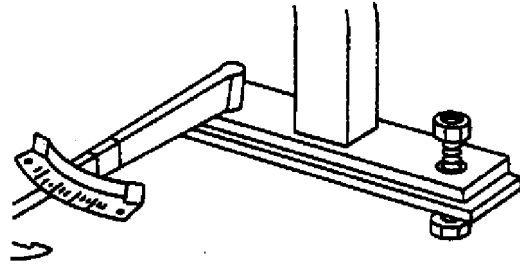

DX,ROPS3 -19-03MAR93

210
05
-UN-23AUG88
TS212

SERVICE TIRES SAFELY


Explosive separation of a tire and rim parts can cause serious injury or death.

Do not attempt to mount a tire unless you have the proper equipment and experience to perform the job.

Always maintain the correct tire pressure. Do not inflate the tires above the recommended pressure. Never weld or heat a wheel and tire assembly. The heat can cause an increase in air pressure resulting in a tire explosion. Welding can structurally weaken or deform the wheel.

When inflating tires, use a clip-on chuck and extension hose long enough to allow you to stand to one side and NOT in front of or over the tire assembly. Use a safety cage if available.

Check wheels for low pressure, cuts, bubbles, damaged rims or missing lug bolts and nuts.

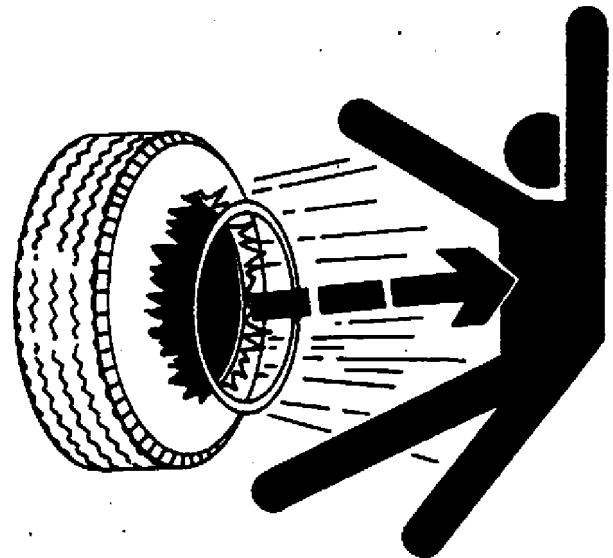

DX,RIM -19-24AUG90

-UN-23AUG88
TS211

210
05
10


AVOID HARMFUL ASBESTOS DUST

Avoid breathing dust that may be generated when handling components containing asbestos fibers. Inhaled asbestos fibers may cause lung cancer.

Components in products that may contain asbestos fibers are brake pads, brake band and lining assemblies, clutch plates, and some gaskets. The asbestos used in these components is usually found in a resin or sealed in some way. Normal handling is not hazardous as long as airborne dust containing asbestos is not generated.

Avoid creating dust. Never use compressed air for cleaning. Avoid brushing or grinding material containing asbestos. When servicing, wear an approved respirator. A special vacuum cleaner is recommended to clean asbestos. If not available, apply a mist of oil or water on the material containing asbestos.

Keep bystanders away from the area.

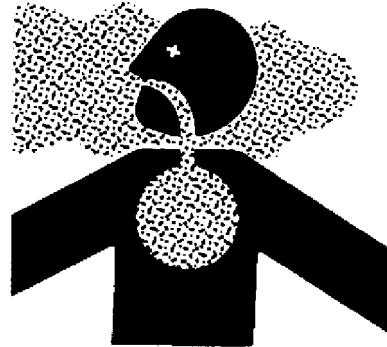

TS220 -UN-23AUG68

DX,DUST -19-15MAR91

PRACTICE SAFE MAINTENANCE

Understand service procedure before doing work. Keep area clean and dry.

Never lubricate, service, or adjust machine while it is moving. Keep hands, feet, and clothing from power-driven parts. Disengage all power and operate controls to relieve pressure. Lower equipment to the ground. Stop the engine. Remove the key. Allow machine to cool.

Securely support any machine elements that must be raised for service work.

Keep all parts in good condition and properly installed. Fix damage immediately. Replace worn or broken parts. Remove any buildup of grease, oil, or debris.

Disconnect battery ground cable (-) before making adjustments on electrical systems or welding on machine.



TS216 -UN-23AUG88

DX,SERV -19-03MAR93